

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

CHILD SEATS:

None during May 2014.

EQUIPMENT:

Thermo King Corporation (Thermo King) is recalling certain Precedent C-600, S-600, S-600M, and S-700 refrigeration units manufactured December 2012 through April 30, 2014, used to provide temperature control for cargo inside truck semi-trailers. The affected refrigeration units have plastic side panels used to access the unit for servicing. Due to wind or air turbulence, these panels may open and break or detach from the refrigeration unit. If a panel, or pieces of it, detach from the unit, they may become a road hazard, increasing the risk of a crash. Thermo King will notify owners, and dealers will install redesigned attachment hardware and locking mechanisms for the panels, free of charge. The recall began on June 9, 2014. Owners may contact Thermo King customer service at 1-952-887-2200.

14E-020

Harley-Davidson Motor Company (Harley-Davidson) is recalling certain accessory Chrome Hand Control Lever Kits, part number 36700053, intended for use on 2014 Harley Davidson XL Sportster motorcycles. The affected kits may have an excess of chrome plating on the brake lever which could prevent the full return of the front brake master cylinder piston. If the brake master cylinder piston does not return to the proper position, the front brake pressure would not be relieved and the front wheel may lock up, increasing the risk of a crash. Harley-Davidson will notify owners, and dealers will inspect and replace the affected front brake levers, as necessary, free of charge. The recall began on June 17, 2014. Owners may contact Harley-Davidson customer service at 1-800-258-2464. Harley-Davidson's number for this recall is 0156.

14E-023

SAF-Holland is recalling certain CXB Trailer Suspension Air Ride Axle Systems. The affected trailer suspensions have pivot bolts that may fail. Failure of the pivot bolts may cause the suspension and attached axle to separate from the trailer that it was connected to, increasing the risk of a crash. SAF-Holland will notify owners, and dealers will replace the defective pivot bolts with new pivot bolts, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact SAF-Holland customer service at 1-888-396-6501. SAF-Holland's recall number for this campaign is P022.

14E-024

Agility Fuel Systems (Agility) is recalling certain compressed natural gas (CNG) Fuel Tank Systems manufactured September 2010 through January 2013. In the affected fuel systems, due to a separation of the valve seat from the valve stem, the manual tank shutoff valve can get internally stuck in the closed position while being opened, although the knob may indicate that the valve is open. If the valve is stuck closed, the flow of fuel would be blocked from the fuel container to the engine. Such a condition poses a safety risk to service personnel as there is no safe way to depressurize the fuel system and service the subject valve when it is stuck in the closed position, increasing the risk of injury to the service personnel. There may also be a small fuel leak through the valve stem when the valve seat becomes detached, increasing the risk of fire. The affected fuel container may also become over-pressurized if the stuck valve goes undetected for a period of time, or is not repaired in a

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

timely manner, and the ambient temperature increases significantly. Agility will notify owners, and Agility field personnel will replace the valve seat and stem assembly, free of charge. The recall is expected to begin in early July 2014. Owners may contact Agility's customer service at 1-949-236-5520.

14E-025

Agility Fuel Systems (Agility) is recalling certain compressed natural gas (CNG) Tank Rail Mount Systems manufactured September 2010 through January 2013. The affected mounting systems may allow the CNG tank to rotate or move within the mounting system which could damage the fuel and vent lines. If the high-pressure fuel and vent lines may become damaged, a fuel leak may result, increasing the risk of a fire. Additionally, the fuel line may become pinched disrupting the flow of fuel to the engine, increasing the risk of a stall. Agility will notify owners, and Agility field personnel will install revised stainless steel mounting straps, hardware and rubber isolators. The recall is expected to begin in early July 2014. Owners may contact Agility customer service at 1-949-236-5520.

14E-026

Ford Motor Company (Ford) is recalling certain all weather driver side accessory floor mats sold for use in model year 2006-2011 Ford Fusion and Mercury Milan, 2006 Lincoln Zephyr, and 2007-2011 Lincoln MKZ vehicles manufactured November 9, 2007, through October 31, 2010. The affected floor mats may move and possibly interfere with the accelerator pedal. The floor mat could shift such that it could interfere with the accelerator pedal, preventing its to return to an idle position, which could result in unintended vehicle speeds, increasing the risk of a crash. Ford will notify owners, and dealers will install new replacement mats, free of charge. The recall is expected to begin by July 25, 2014. Owners may contact Ford's customer service at 1-800-392-3673. Ford's number for this recall is 14S07. NOTE: Vehicles built after October 31, 2010, while potentially equipped with the same floor mats, are equipped with a Brake Over Accelerator (BOA) feature that prevents simultaneous accelerator and brake application, allowing the vehicle to be safely stopped by pressing firmly and steadily on the brake pedal.

14E-028

TIRES:

None during May 2014.

VEHICLES:

Polaris Industries, Inc. (Polaris) is recalling certain model year 2014 Victory Cross Country, Cross Country Eight Ball, Hammer Eight Ball, High Ball, Jackpot, Judge, Ness Cross Country, Vegas Eight Ball, Vision, Boardwalk, and 2015 Victory Gunner motorcycles manufactured January 22, 2014, through April 25, 2014. The crankcase may have been machined incorrectly causing insufficient clearance between the crankshaft and crankcase, causing the engine to unexpectedly seize. Engine seizure may cause the operator to lose control of the motorcycle, increasing the risk of a crash. Polaris will notify owners, and dealers will inspect and correct the

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING MAY 2014

Published July 3, 2014

crankcase clearance, as necessary, free of charge. The recall began on May 20, 2014. Owners may contact Polaris customer service at 1-888-704-5290. Note: Owners are advised not to ride their motorcycle until the recall remedy has been performed.

14V-227

Coach and Equipment Mfg. Corp. (Coach and Equipment) is recalling certain model year 2013 Metro Lite transit buses manufactured May 2013 through June 2013 and Phoenix transit buses manufactured March 2013 through April 2013 and equipped with certain Ricon S-series and K-series wheelchair lifts, with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Coach and Equipment will notify owners, and Ricon will send the owner a supplemental cover kit and instructions free of charge. Owners may contact Coach and Equipment customer service at 1-315-536-2321 or Ricon Customer Service at 1-800-322-2884 or by e-mail at recall.admin@wabtec.com.

14V-228

Nissan North America, Inc. (Nissan) is recalling certain model year 2014 Pathfinder and Rogue vehicles and 2014 Infiniti QX60 vehicles. The right side wheels of the affected vehicles may have one lug nut each that was not properly tightened. If the lug nut becomes loose from not being properly tightened, it may fall off, allowing the other lug nuts to become loose, possibly resulting in a wheel separation, and increasing the risk of a crash. Nissan will notify owners, and dealers will inspect and tighten any loose lug nuts to the correct specification, free of charge. Owners may contact Nissan customer service at 1-800-647-7261.

14V-229

HME, Inc. is recalling one model year 2013 Ferrara Intruder Ember Cab and Chassis emergency vehicle equipped with IMMI-brand L9 seat belt buckles. When the button is pressed to release the seat belt, the latch plate can become partially engaged with the buckle, making the seat belt difficult to unlatch. As such, this vehicle fails to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 209, "Seat Belt Assemblies." If the latch plate remains partially engaged after the button is pressed, egress from the vehicle could be hindered which would increase the risk of injury in the event of an emergency. HME notified the owner, and a dealer will inspect the vehicle and replace the seat belt buckles, as necessary, free of charge. The recall began in June 2014. Owners may contact HME at 1-616-534-1463.

14V-230

Federal Coach, Inc. (Federal) is recalling certain model year 2010 Spirit and Premier transit buses, equipped with A&M Systems-brand door actuators. Voltage spikes may damage electrical components and electrical circuits, causing the actuator's circuit board to develop high resistance. High resistance may cause the board to overheat, increasing the risk of a fire. Federal notified owners and dealers will replace the circuit board, free of charge. The recall began in June 2014. Owners may contact Federal at 1-800-348-7440.

14V-231

WMK Inc., doing business as Mobility Works, Inc. (Mobility), is recalling certain model year 2013-2014

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

Mobility-modified Ford E-150, and E-250 transit buses manufactured December 1, 2013, through January 4, 2014, and equipped with certain Ricon S series and K series wheelchair lifts, with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Mobility will notify owners, and Ricon will send the owner a supplemental cover kit and instructions free of charge. Owners may contact Mobility customer service at 1-800-769-8267, or Ricon Customer Service at 1-800-322-2884 or by e-mail at recall.admin@wabtec.com.

14V-232

Keystone RV Company (Keystone) is recalling certain model year 2014 Dutchmen Infinity fifth wheel trailers, models 3210RE, 3610RL and 3710BH, manufactured August 1, 2013, through April 3, 2014. In the affected vehicles, the leading edge of the interior steps may fracture. If the interior steps fracture, a person may fall, increasing the risk of injury. Keystone will notify owners, and dealers will install a brace kit to provide additional support for the steps, free of charge. Owners may contact Keystone customer service at 1-866-425-4369. Keystone's number for this recall is 14-206.

14V-233

Chrysler Group, LLC (Chrysler) is recalling certain model year 2010-2014 Chrysler Town and Country and Dodge Grand Caravan vehicles manufactured August 25, 2010, through October 31, 2013. The affected vehicles may experience overheating of the vent window switch in the driver's door armrest. An overheated switch may result in a vehicle fire. Chrysler will notify owners, and dealers will replace the vent window switch with a newer version, free of charge. An interim letter was distributed out on June 30, 2014. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is P25.

14V-234

Chrysler Group, LLC (Chrysler) is recalling certain model year 2013-2014 Fiat 500e Battery Electric Vehicles (BEV) vehicles manufactured September 24, 2012, through April 4, 2014. The affected vehicles have cooling plates for the Power Inverter Module (PIM) that may leak coolant into areas of the high voltage circuitry, resulting a short circuit that could cause the related service fuse to blow. If the service fuse blows, the vehicle would have a loss of propulsion while driving, increasing the risk of a crash. Chrysler will notify owners, and dealers will replace the PIM, free of charge. The recall is expected to begin in July 2014. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is P23.

14V-235

Ford Motor Company (Ford) is recalling certain model year 2013-2014 C-MAX, and Escape vehicles. In the affected vehicles, the restraint control module (RCM) may have errors in the programming software which may result in a delayed deployment of the side-curtain rollover air bag. If the side-curtain rollover air bag is delayed in deploying in certain rollover circumstances, the risk of injury to the passengers is increased. Ford will notify owners, and dealers will reprogram the RCM, free of charge. The recall began on May 30, 2014. Owners may contact Ford customer service at 1-800-392-3673. Ford's number for this recall is 14S04.

14V-237

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

Ford Motor Company (Ford) is recalling certain model year 2013-2014 Escape vehicles manufactured October 5, 2011, through April 10, 2014. Due to an assembly misalignment between the exterior door handle and the door outer panel, the affected vehicles have doors that may be difficult to close or may possibly open while driving. A door that opens unexpectedly may result in an unrestrained occupant falling from the vehicle, increasing the risk of injury. Ford will notify owners, and dealers will inspect and correct the mounting of the door handles, as necessary, free of charge. The recall began on May 30, 2014. Owners may contact Ford customer service at 1-800-392-3673. Ford's number for this recall is 14S03.

14V-239

General Motors LLC (GM) is recalling certain model year 2014 Buick Lacrosse vehicles manufactured January 29, 2014, through March 31, 2014 and 2014 Chevrolet Malibu vehicles manufactured February 7, 2014, through March 31, 2014, and equipped with 17 inch front brake rotors. The affected vehicles may have had brake rotors intended for the rear of the car accidentally installed on the front. The rear rotors, while the same diameter, are thinner and may result in a front brake pad detaching from the caliper. If a brake pad detaches from caliper, there may be a sudden reduction in braking, lengthening the distance required to stop the vehicle and increasing the risk of a crash. GM will notify owners, and dealers will inspect the front brake rotors, and install the correct rotors with new brake pads, as necessary, free of charge. The recall began on June 20, 2014. Owners may contact General Motors customer service at 1-800-521-7300 (Buick) or 1-800-222-1020 (Chevrolet). GM's number for this recall is 14128.

14V-240

Turtle Top is recalling certain model year 2013 Odyssey and Van Terra transit buses manufactured April 11, 2013, through December 5, 2013, and equipped with certain Ricon S series and K series wheelchair lifts with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed nonconductive cover, a short circuit may occur that could result in a fire. Turtle Top will notify owners, and Ricon will send the owner a supplemental cover kit and instructions, free of charge. The recall began in June 2014. Owners may contact Turtle Top customer service at 1-800-296-2105 or Ricon Customer Service at 1-800-322-2884 or by e-mail at recall.admin@wabtec.com. Note: This campaign is a continuation of 13V-263.

14V-241

Pierce Manufacturing (Pierce) is recalling certain model year 2013 Arrow XT, Dash CF, Impel, and Velocity vehicles manufactured October 2013 through January 2014, and equipped with IMMI-brand L9 seat belt buckles. When the button is pressed to release the seat belt, the latch plate can become partially engaged with the buckle, making the seat belt difficult to unlatch. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 209, "Seat Belt Assemblies." If the latch plate remains partially engaged after the button is pressed, egress from the vehicle could be hindered which would increase the risk of injury in the event of an emergency. Pierce will notify owners, and dealers will inspect and replace the seat belt buckle, as necessary, free of charge. The recall began on June 26, 2014. Owners may contact Pierce at 1-888-974-3723. Pierce's number for this campaign is 74B246.

14V-243

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

Supreme Corporation (Supreme) is recalling certain model year 2013 Senator, Senator II, Trolley, President, Heavy Duty, and Activity transit buses and trolleys manufactured December 15, 2012, through December 31, 2013, and equipped with certain Ricon S series and K series wheelchair lifts, with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Supreme will notify owners, and Ricon will send the owners a supplemental cover kit and instructions, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Supreme customer service at 1-574-642-4888, or Ricon Customer Service at 1-800-322-2884 or by e-mail at recall.admin@wabtec.com.

14V-244

Hyundai Motor Company (Hyundai) is recalling certain model year 2011-2014 Hyundai Tucson vehicles manufactured January 3, 2011, through December 23, 2013. In the affected vehicles, the air bag assembly installed in the steering wheel may come loose from its mounting. An air bag assembly that is not properly mounted may result in an increased risk of injury to the driver in the event of a crash. Hyundai will notify owners, and dealers will inspect and tighten the bolts that secure the driver's air bag assembly, free of charge. The recall began on May 9, 2014. Owners may contact Hyundai customer service at 1-800-633-5151. Hyundai's number for this recall is 118.

14V-245

General Motors LLC (GM) is recalling certain model year 2014 Chevrolet Silverado vehicles manufactured May 23, 2013, through March 25, 2014, 2014 GMC Sierra vehicles manufactured May 25, 2013, through March 31, 2014, and 2015 Chevrolet Tahoe vehicles manufactured January 29, 2014, through March 27, 2014. In the affected vehicles, the tie rod threaded attachment may not be properly tightened to the steering gear rack. An improperly tightened tie rod attachment may allow the tie rod to separate from the steering rack, resulting in a loss of steering, increasing the risk of a vehicle crash. GM notified all owners, and dealers will inspect the inner tie rods to make sure that they are correctly tightened, replacing the steering gear, as necessary, free of charge. The recall began on May 14, 2014. Owners may contact General Motors customer service at 1-800-222-1020 (Chevrolet), or 1-800-462-8782 (GMC). GM's number for this recall is 14204. NOTE: Owners are advised not to drive their vehicles until they have been inspected and repaired. Owners should contact GM to have their vehicles towed to the dealership.

14V-246

General Motors LLC (GM) is recalling certain model year 2014 Chevrolet Malibu vehicles manufactured June 12, 2013, through May 2, 2014, and equipped with a 2.5L engine with the auto stop/start option. The affected vehicles may experience a complete loss of brake vacuum assist, disabling the hydraulic boost assist. As such, these vehicles do not comply with Federal Motor Vehicle Safety Standard (FMVSS) number 135, "Light Vehicle Brake Systems." If the hydraulic boost assist is disabled, slowing or stopping the vehicle will require additional brake pedal effort and a lengthened stopping distance. Both of these effects increase the risk of a crash. GM will notify owners, and dealers will update the electronic brake control module software, free of charge. The recall is expected to begin during July 2014. Owners may contact General Motors customer service at 1-800-222-1020. General Motors number for this recall is 14201.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

14V-247

Jerr-Dan Corporation (Jerr-Dan) is recalling certain model year 2007-2014 Standard Duty Wreckers manufactured November 1, 2007, through March 3, 2014. In the affected vehicles, the underlift boom tilt cylinder may drift down while a vehicle is being towed. If the underlift boom tilt cylinder drifts down during towing, the vehicle that is being towed may contact the road surface, increasing the risk of the vehicle crash. Jerr-Dan will notify owners and dealers will correct the problem, free of charge. The remedy for this campaign is still under development. The recall will begin by mid-July 2014. Owners may contact Jerr-Dan customer service at 1-800-926-9666.

14V-248

Seagrave Fire Apparatus, LLC (Seagrave) is recalling certain model year 2013-2014 TB30CS, TT06CX, XVOICS emergency vehicles, and 2014 TVOHCX, and TB50CO emergency vehicles equipped with IMMI-brand L9 seat belt buckles. When the button is pressed to release the seat belt, the latch plate can become partially engaged with the buckle, making the seat belt difficult to unlatch. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 209, "Seat Belt Assemblies." If the latch plate remains partially engaged after the button is pressed, egress from the vehicle could be hindered which would increase the risk of injury in the event of an emergency. Seagrave has notified owners, and dealers will inspect and replace the seat belt buckle, as necessary, free of charge. The recall begin late July 2014. Owners may contact Seagrave at 1-800-732-4728.

14V-249

Elgin Sweeper Company (Elgin) is recalling certain model year 2013 Pelican street sweepers equipped with IMMI-brand L9 seat belt buckles. When the button is pressed to release the seat belt, the latch plate can become partially engaged with the buckle, making the seat belt difficult to unlatch. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 209, "Seat Belt Assemblies." If the latch plate remains partially engaged after the button is pressed, egress from the vehicle could be hindered which would increase the risk of injury in the event of an emergency. Elgin will notify owners, and dealers will inspect and replace the seat belt buckle, as necessary, free of charge. The recall is expected to begin in early July 2014. Owners may contact Elgin at 1-847-741-5370.

14V-250

General Motors LLC (GM) is recalling certain model year 2005-2007 Chevrolet Corvette vehicles manufactured March 29, 2004, through June 22, 2007. In the affected vehicles, the underhood bussed electrical center (UBEC) housing can expand and cause the headlamp low beam relay control circuit wire to bend. If the wire is repeatedly bent, it may fracture causing a loss of low beam headlamp illumination. The loss of low beam headlamp illumination will decrease the driver's visibility, as well as the vehicle's conspicuity to other motorists, increasing the risk of a crash. GM will notify owners, and dealers will replace the UBEC housing unit, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 13146. Note: Model year 2008-2013 Chevrolet Corvettes will be covered under customer satisfaction program number 14203 for the same issue.

14V-251

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

General Motors LLC (GM) is recalling certain model year 2004-2012 Chevrolet Malibu vehicles manufactured May 16, 2003, through October 11, 2012, 2004-2007 Malibu Maxx vehicles manufactured June 25, 2003, through April 5, 2007, 2005-2010 Pontiac G6 vehicles manufactured May 26, 2004, through January 4, 2010, and 2007-2010 Saturn Aura vehicles manufactured April 24, 2006, through May 26, 2009. In the affected vehicles, increased resistance in the Body Control Module (BCM) connection may result in voltage fluctuations in the Brake Apply Sensor (BAS) circuit. These fluctuations can cause one or more of these conditions: the brake lights to illuminate without the brake pedal being pushed; the brake lights to not illuminate when the pedal is pushed; difficulty disengaging the cruise control; moving the gear shifter out of the 'PARK' position without pushing the brake; and disablement of crash avoidance features such as traction control, electronic stability control, and panic braking assist features. Any of the above failure conditions increases the risk of a crash. GM will notify owners, and dealers will attach the wiring harness to the BCM with a spacer, apply dielectric lubricant to both the BCM and harness connector and the BAS and harness connector, and will relearn the brake pedal home position, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact General Motors customer service at 1-800-222-1020 (Chevrolet), 1-800-762-2737 (Pontiac), 1-800-553-6000 (Saturn). GM's number for this recall is 13036.

14V-252

General Motors LLC (GM) is recalling certain model year 2014 Cadillac CTS vehicles manufactured June 10, 2013, through February 26, 2014. If the vehicle is turned off with wiper functionality left on and the wipers then become restricted, such as when covered in ice or snow, and the vehicle's battery goes dead and needs to be jump started, upon being jump started, the wipers will be inoperative. An inoperative windshield wiper system may decrease the driver's visibility, increasing the risk of a crash. GM will notify owners, and dealers will replace the front wiper module, free of charge. The recall is expected to begin mid-July 2104. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is 14157.

14V-253

Lodal, Inc. (Lodal) is recalling certain model year 2011-2013 Evo garbage trucks manufactured January 12, 2011, through December 31, 2013, and equipped with certain Cummins Westport Model ISL G engines. Condensation in the intake manifold may freeze during cold weather conditions and interfere with the proper operation of the intake manifold pressure sensor. The improper operation of the sensor could induce elevated exhaust temperatures or flames from the exhaust pipe, increasing the risk of a vehicle fire or burn injury to a person near the exhaust pipe. Cummins Inc. and Cummins Wesport Inc. will notify owners, and authorized Cummins service facilities will upload a new ECM calibration, free of charge. The manufacturers have not yet provided a schedule for notifying vehicle owners. Owners may contact Lodal at 1-800-435-3500 or Cummins Inc. at 1-800-343-7357.

14V-255

Trans Tech Bus is recalling certain model year 2013 SC139DSFP500 school buses equipped with certain Ricon S-series and K-series wheelchair lifts with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Trans Tech Bus will notify owners and

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

Ricon will send the owner a supplemental cover kit and instructions, free of charge. The recall began on June 18, 2014. Owners may contact Trans Tech Bus customer service at 1-845-988-2333, or Ricon Customer Service at 1-800-322-2884 or by e-mail at recall.admin@wabtec.com.

14V-256

Champion Bus, Inc. (Champion) is recalling certain model year 2013 Challenger transit buses manufactured January 7, 2013, through October 25, 2013, and equipped with certain Ricon S series and K series wheelchair lifts and an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. Champion will notify owners and Ricon will send the owner a supplemental cover kit and instructions free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Champion customer service at 1-800-776-4943, or Ricon at 1-818-267-3000. Champion's number for this recall is 14E-010.

14V-257

American Honda Motor Co., Ltd. (Honda) is recalling certain model year 2013 Honda Fit vehicles manufactured May 24, 2013, through July 5, 2013, and equipped with a manual transmission. The passenger side driveshaft may break while driving due to an improper heat treatment application during manufacturing. If the driveshaft fractures and separates while driving, the vehicle would lose power and coast to a stop. If a vehicle with a fractured driveshaft is parked without the parking brake applied, the vehicle could move unexpectedly. Either condition increases the risk of a crash. Honda will notify owners, and dealers will inspect the passenger side driveshaft and replace it if necessary, free of charge. The recall began on June 23, 2014. Owners may contact Honda customer service at 1-800-999-1009. Honda's number for this recall is JE4.

14V-258

General Motors LLC (GM) is recalling certain model year 2015 Cadillac Escalade and Escalade ESV vehicles manufactured April 6, 2014, through May 13, 2014. In the affected vehicles, the air bag module is secured to a chute adhered to the backside of the instrument panel with an insufficiently heated infrared weld. This may result in only a partial deployment of the front passenger air bag in the event of a crash. As such, these vehicles do not conform to Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." In the event of an accident, an air bag that only partially deploys increases the risk of occupant injury. GM sent the owners an interim notification letter on May 16, 2014 to advise owners of the recall, and will mail owners a second letter when remedy parts are available. When the parts are available, dealers will replace the instrument panel right side upper trim panel, free of charge. The recall began on June 9, 2014. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is 14220. Note: Owners are advised that until the vehicle has been remedied, occupants should not sit in the front passenger seat position.

14V-259

General Motors is recalling certain model year 2004-2008 Chevrolet Optra vehicles. In the affected vehicles there may be heat generated in the headlamp switch or daytime running light (DRL) module and the heat could melt the headlamp switch or the DRL module. If the heat generated within the headlamp switch and DRL module

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

located on the left side of the steering column melts the headlamp switch or DRL module, it increases the risk of a vehicle fire. The remedy for this recall campaign is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact General Motors at 1-800-222-1020 (Chevrolet). General Motors' recall number for this campaign is 14093.

14V-260

General Motors is recalling certain model year 2004-2008 Chevrolet Aveo vehicles equipped with daytime running lights (DRL). In the affected vehicles, there may be heat generated within the DRL module located in the center console in the instrument panel, which could melt the DRL module. If the DRL module melts due to the heat generation, it could cause a vehicle fire. The remedy for this recall campaign is still under development. The manufacturer has not yet provided a notification schedule. Owners may contact General Motors customer service at 1-800-222-1020 (Chevrolet). General Motors recall number for this campaign is 14236.

14V-261

Suzuki Motor of America, Inc. (Suzuki) is recalling certain model year 2004-2008 Forenza vehicles, and 2005-2008 Reno vehicles manufactured from September 1, 2003, through July 30, 2008. In the affected vehicles, heat may be generated in the headlamp switch or daytime running light (DRL) module which could melt the headlamp switch or the DRL module. If the heat generated within the headlamp switch or DRL module located on the left side of the steering column melts the headlamp switch or DRL module, there is an increased risk of a fire. Suzuki will notify owners but the manufacturer has not yet provided a notification schedule. Suzuki will replace the signal switch and add a jumper relay kit and will replace the DRL Module in the instrument panel harness. Owners may contact Suzuki at 1-800-934-0934. Suzuki's number for this recall is XA.

14V-262

Nissan North America, Inc. (Nissan) is recalling certain model year 2014 Nissan LEAF vehicles manufactured April 15, 2014, through April 24, 2014. Due to a problem with the motor control circuit board, the inverter may fail, causing the vehicle shut down. An unexpected vehicle shut down increases the risk of a crash. Nissan will notify owners, and dealers will replace the inverter, free of charge. The recall is expected to begin on July 7, 2014. Owners may contact Nissan customer service at 1-800-647-7261.

14V-263

BMW of North America, LLC (BMW) is recalling certain model year 2012-2014 C 600 Sport, and C 650 GT motorcycles manufactured August 2, 2012, through February 18, 2014. In the affected vehicles, the camshaft chain tensioner may not function properly, resulting in an engine stall. An engine stall may increase the risk of a crash. BMW will notify owners, and dealers will replace the camshaft chain tensioner, free of charge. The recall is expected to begin in July 2014. Owners may contact BMW Customer Relations at 1-800-525-7417.

14V-264

General Motors LLC (GM) is recalling certain model year 2015 Chevrolet Silverado HD vehicles manufactured January 8, 2014, through February 27, 2014, and 2015 GMC Sierra HD vehicles manufactured January 9, 2014, through February 14, 2014, and equipped with a 220 Amp Generator (RPO KW5). In the affected vehicles, the retention clips that attach the fuse block to the vehicle body can become loose allowing the fuse

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

block to move out of position. If this occurs, exposed conductors in the fuse block may contact the mounting studs or other metallic components, causing a short to ground event. This could result in an arcing condition, and combustible materials located nearby could ignite and result in an engine compartment fire. GM will notify owners, and dealers will inspect the fuse block to verify that it is properly secured, repairing it as necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-800-222-1020 (Chevrolet) or 1-800-462-8782 (GMC). GM's number for this recall is 14208.

14V-265

General Motors is recalling certain model year 2009-2014 Buick Enclave vehicles manufactured April 14, 2008, through May 14, 2014, Chevrolet Traverse vehicles manufactured June 6, 2008, through May 14, 2014, and GMC Acadia vehicles manufactured April 9, 2008, through May 14, 2014, and 2009-2010 Saturn Outlook vehicles manufactured April 14, 2008, through March 18, 2010. In the affected vehicles, the flexible steel cable that connects the seatbelt to the front outboard seating positions may fatigue and separate over time. If the steel cable becomes fatigued and separates, the seatbelt may not properly restrain the seat occupant increasing the risk of an injury in a crash. General Motors will notify owners, and dealers will inspect and, if necessary, repair and replace the lap pretensioner, free of charge. Parts are not currently available. An interim notice will be mailed to owners in July 2014. A second notice will be mailed to owners once parts become available. The manufacturer has not yet provided a notification schedule. Owners may contact General Motors at 1-800-222-1020 (Chevrolet), 1-800-521-7300 (Buick), 1-800-462-8782 (GMC), 1-800-553-6000 (Saturn). General Motors recall number for this campaign is 14187.

14V-266

Thor Industries is recalling certain model year 2014-2015 Outlaw 29H motorcoaches manufactured January 13, 2014, through April 25, 2014. In the affected vehicles, the generator exhaust may be routed too close to the onboard propane storage tank without the necessary heat shielding. Additionally, the generator exhaust ends underneath a slide-out room. Due to the exhaust's proximity and the lack of heat shielding, the hot exhaust piping could heat the propane tank and cause it to expand and vent off any build up of pressure, increasing the risk of a fire. The exhaust exiting below a slide out room may cause carbon monoxide to enter the vehicle, increasing the risk of asphyxiation. Thor will notify owners, and dealers and replace the existing generator exhaust pipe with a new pipe that has a different routing, free of charge. Owners may contact Thor customer service at 1-877-500-1020. Thor's recall number for this campaign is RC000089.

14V-267

Stoughton Trailers, LLC (Stoughton) is recalling certain 2014 AVW trailers manufactured October 22, 2013, through December 18, 2013, AVXW trailers manufactured December 3, 2013, through December 16, 2013, ZGPVW trailers manufactured October 17, 2013, through December 17, 2013, and AHV trailers manufactured November 5, 2013, through November 21, 2013, and equipped with certain SAF-Holland-brand CBX Trailer Suspension Air Ride Axle Systems. The affected trailer suspensions have pivot bolts that may fail. Failure of the pivot bolts may cause the suspension and attached axle to separate from the trailer, increasing the risk of a crash. Stoughton will notify owners, and SAF-Holland-approved repair shops will replace the defective pivot bolts with new pivot bolts, free of charge. The recall is expected to begin by mid-July 2014. Owners may contact Stoughton customer service at 1-608-873-2555, or SAF-Holland customer service at 1-888-396-6501.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

14V-268

ElDorado National-Kansas Inc. (ElDorado) is recalling certain model year 2012-2014 Aerotech 240 vehicles, equipped with certain Ricon S series and K series wheelchair lifts with an optional armored pendant cable. The armored cable may be positioned such that it does not clear the wheelchair lift. If the cable does not clear the wheel chair lift it may contact the power lug and if it does not have a nonconductive cover, or it has an improperly installed non-conductive cover, then a short circuit may occur that could result in a fire. ElDorado will notify owners, and Ricon will send the owner a supplemental cover kit and instructions free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact ElDorado customer service at 1-800-850-1287 or Ricon Customer Service at 1-800-322-2884 or by e-mail at recall.admin@wabtec.com. ElDorado's number for this recall is 14E-010.

14V-269

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2013 Lexus GS 350 vehicles manufactured June 8, 2012, through December 26, 2012. In the affected vehicles, the switch that senses the amount of pressure that the driver is applying to the brake pedal may fail. If the switch fails, the vehicle may begin braking without the driver's input, and without illuminating the brake lights, increasing the risk of a crash. Toyota will notify owners, and dealers will replace the brake pedal support assembly which includes the brake pedal load sensing switch, free of charge. Parts for the remedy are not currently available. Toyota will send owners an interim notification letter to advise owners of the recall, and will mail owners a second letter when remedy parts are available. Owners may contact Toyota customer service at 1-800-331-4331.

14V-270

Tiffin Motorhomes, Inc. (Tiffin) is recalling certain model year 2009-2011 Allegro, 2010-2011 Bus and Breeze, and 2008-2011 Phaeton and Zephyr recreational vehicles, equipped with LED clearance lights made by Command Electronics, Inc. In the affected vehicles, moisture may enter the light and cause a short between two connections on the circuit board. A short in the circuit board increases the risk of a fire. Tiffin will notify owners, and dealers will install a one amp inline fuse into the front and rear circuits that will blow if there is a short in any of the clearance lights, free of charge. The recall is expected to begin in July 2014. Owners may contact Tiffin customer service at 1-256-356-8661.

14V-271

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2014 Highlander and Highlander Hybrid vehicles. The affected vehicles may have improper software installed in the air bag electronic control unit (ECU) for the operation of the front passenger seat belt force limiter, and as a result, the force limiter may use the restraint setting designed for small occupants, such as those that weigh approximately 110 pounds, for all occupants regardless of their size. As such, some of these vehicles do not conform to Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection." In the event of a crash, a larger front passenger seat occupant may not be properly restrained and be at an increased risk of injury. Toyota will notify owners, and dealers will install a software update in the air bag electronic control unit, free of charge. The recall began on June 27, 2014. Owners may contact Toyota customer service at 1-800-331-4331.

14V-272

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2004-2011 Sienna vehicles originally sold in, or currently registered in, Connecticut, Delaware, Illinois, Indiana, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, Virginia, West Virginia, Wisconsin and the District of Columbia. The affected vehicles have a spare tire carrier assembly mounted under the vehicle whose attachment cable may corrode due to high concentrations of road salt splashing onto the spare tire carrier. If the carrier cable is corroded due to road salt, the spare tire may separate from the vehicle, increasing the risk of a crash. Toyota will send owners an interim notification to advise owners of the recall and dealers will remove the spare tire and relocate it to the luggage compartment, free of charge. Owners will be mailed a second letter when remedy parts are available and dealers will replace the spare tire carrier assembly with an improved one, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Toyota customer service at 1-800-331-4331.

NOTE: 2004-2010 Siennas subject to this recall were subject to recall campaign 10V-160 initiated in 2010. Those owners are advised that they must have their vehicles remedied again under this campaign and that having the earlier recall completed did not remedy their vehicles. Additionally, model year 1998-2003 Siennas were recalled as part of safety recall 10V-160. Owners of those vehicles that have not had the remedy performed on their vehicles, should contact their Toyota dealer to schedule a free repair.

14V-273

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2014 Highlander vehicles manufactured April 23, 2014, through April 29, 2014. The affected vehicles may have a second row right-hand seat assembly that does not fully lock into the inboard seat track in the forward first, second and third adjusting positions. As such, these vehicles do not conform to Federal Motor Vehicle Safety Standard (FMVSS) number 207, "Seating Systems." If the seat does not fully lock into the inboard seat track, the seat could move, increasing the risk of injury to an occupant in the event of a crash. Toyota will notify owners, and dealers will inspect and, if necessary, replace the second row right-hand seat, free of charge. Owners may contact Toyota customer service at 1-800-331-4331.

14V-274

Great Dane Trailers (Great Dane) is recalling certain model year 2015 Dry Freight Semi-Trailers. The affected trailers may be missing a weld from the pintle hook to the bogie tube. The missing weld could result in trailer separation, increasing the risk of a crash. Great Dane has notified the affected owner, and Great Dane is inspecting the trailers and applying the missing welds, free of charge. The recall began in May 2014. Owners may contact Great Dane customer service at 1-877-369-3493.

14V-275

Van Hool N.V. (Van Hool) is recalling certain model year 2004, 2006, and 2013 C2045 Coaches, equipped with Sure Power Battery Equalizers containing a particular epoxy sealing, aka 'potting', compound. The specific potting compound used in the subject products for insulation was found to be capable of conducting electricity after being exposed to heat. Once electrically conductive, the material is capable of melting and burning, increasing the risk of a fire. Van Hool's designated agent, ABC Bus, Inc., will notify Van Hool owners, and Sure Power will replace the converters, free of charge. The recall is expected to begin in July 2014. Van Hool's number for this recall is P725

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

14V-276

Suzuki Motor of America, Inc. (Suzuki) is recalling certain model year 2014 DL650A V-Strom motorcycles manufactured January 20, 2014, through January 21, 2014. In the affected vehicles, a drive chain link may not have been riveted by the supplier when being manufactured. If the drive chain link was not riveted, the chain may come off, increasing the risk of a vehicle crash. Suzuki will notify owners, and dealers will inspect the drive chains of the affected motorcycles. For any unsold motorcycles with a drive chain link that is not riveted, Suzuki dealers will replace the non-riveted link with a drive chain joint set. For any motorcycles that have been sold to retail customers with a drive chain link that is not riveted, Suzuki dealers will replace the drive chain and the front and rear sprockets, free of charge. The recall began on May 27, 2014. Owners may contact Suzuki at 1-800-572-1490. Suzuki's number for this recall is 2A39.

14V-278

Mobility Specialists, Inc. (Mobility Specialists) is recalling certain model year 2007-2008 Ford E-150 vans modified by Mobility Specialists and equipped with Braun NCL-2, and NVL-2 wheel chair lifts. Over time, and with frequent use, the roll stop latches on the outer barrier of the lifts in these vans may become bent or misaligned. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury. Mobility Specialists will notify owners and will replace the affected parts, free of charge. The recall is expected to begin in July 2014. Owners may contact Mobility Specialists customer service at 1-877-777-5438.

14V-279

Lotus Cars USA, Inc. (Lotus) is recalling certain model year 2008-2011 Elise and Exige vehicles manufactured from November 2007 to July 2011, and 2011 Evora vehicles manufactured September 2010 through September 2011. The oil cooler hose may detach from its fitting. A detached oil hose could spray oil on a tire, increasing the risk of a crash, or it could spray oil throughout the engine compartment, increasing the risk of a fire. Lotus will notify owners, and dealers will replace the oil cooler hose fittings on the Elise and Exige vehicles and will replace the oil cooler hose assemblies on the Evora vehicles, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Lotus at 1-800-245-6887. Lotus' number for this recall is 201401R (Elise/Exige), and 2014/02R (Evora). Note: This recall is an expansion of recalls 11V-510 and 13V-041.

14V-280

Mitsubishi Motors North America, Inc. (Mitsubishi) is recalling certain model year 2014 Lancer Evolution vehicles manufactured January 31, 2014, through February 21, 2014, and 2014 Lancer Ralliart vehicles manufactured February 3, 2014, through February 14, 2014. The affected vehicles may have insufficient clearance between the power steering pressure tube and the crossmember brace. Due to abrasion and rust, a hole may develop in the power steering tube, allowing the fluid to leak out, resulting in added steering effort, increasing the risk of a crash. Additionally, the leaking fluid increases the risk of a fire in the presence of an ignition source such as a hot engine or exhaust component. Mitsubishi will notify owners, and dealers will inspect the power steering tube for sufficient clearance. If the vehicle has insufficient clearance, the power steering tube assembly will be replaced, free of charge. The manufacturer notified owners in July 2014. Owners may contact

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

Mitsubishi customer service at 1-888-648-7820. Mitsubishi's number for this recall is SR-14-004.

14V-281

Mazda North American Operations (Mazda) is recalling certain model year 2008-2011 Tribute vehicles manufactured October 5, 2006, through September 11, 2010. The affected vehicles have a steering torque sensor that may not be able to properly detect driver steering input. As a result, the system could remove the Electric Power Steering (EPS) assist. If power steering assist is lost, greater driver effort would be required to steer the vehicle at low speeds, increasing the risk of a crash. Mazda will notify owners and dealers will update the software for the power steering control module (PSCM) and the instrument cluster module, free of charge. If a vehicle shows a history of a loss of the torque sensor signal or fault codes relating to the PSCM when the vehicle is brought in for the recall remedy, the affected components will be replaced, free of charge. The recall is expected to begin in July 2014. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 7614E.

14V-282

PACCAR Incorporated (PACCAR) is recalling certain model year 2010-2015 Peterbilt 579, 388, 384, 367, 365, 348, and 337 trucks manufactured October 30, 2009, through May 21, 2014. In the affected vehicles, if power is interrupted to the seat electronic control unit (ECU), such as when the fuse for that circuit blows, the side air bag would be disabled but there will not be a warning lamp indicator to notify the operator of the malfunction. Without a warning of a problem existing in the side air bag system, the driver may continue to operate the vehicle, increasing the risk of injury from the side air bag not deploying in the event of a rollover. PACCAR will notify owners, and dealers will install a new electrical harness to correct them problem, free of charge. The recall is expected to begin in July 2014. Owners may contact Peterbilt customer service at 1-940-591-4220. Paccar's number for this recall is 514-F.

14V-283

Ford Motor Company (Ford) is recalling certain model year 2008-2011 Ford Escape and Mercury Mariner vehicles manufactured August 18, 2006, through September 11, 2010. The affected vehicles have a steering torque sensor that may not be able to properly detect driver steering input. As a result, the system could remove the Electric Power Steering (EPS) assist. If power steering assist is lost, greater driver effort would be required to steer the vehicle at low speeds, increasing the risk of a crash. Ford will notify owners, and dealers will update the software for the power steering control module (PSCM) and the instrument cluster module, free of charge. If a vehicle shows a history of a loss of the torque sensor signal or fault codes relating to the PSCM when the vehicle is brought in for the recall remedy, the affected components will be replaced, free of charge. The recall is expected to begin by July 25, 2014. Owners may contact Ford customer service at 1-800-392-3673. Ford's number for this recall is 14S05.

14V-284

Ford Motor Company (Ford) is recalling certain model year 2010-2014 Taurus vehicles manufactured November 24, 2008, through February 28, 2014, originally sold in, or currently registered in, Connecticut, Delaware, Illinois, Indiana, Iowa, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, Wisconsin and

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

the District of Columbia. When used in areas that use road salt, the license plate lamp assembly may experience an electro-chemical reaction and corrosion as a result of water intrusion. This corrosion may result in a short circuit, increasing the risk of a fire. Ford will notify owners, and dealers will replace the license plate lamp assemblies, free of charge. The recall is expected to begin on July 25, 2014. Owners may contact Ford customer service at 1-800-392-3673. Ford's number for this recall is 14S08. Note: Under program 14R01, Ford will notify owners in non-corrosion states, and, at the customer's request, dealers will replace the license plate lamp assembly.

14V-285

Ford Motor Company (Ford) is recalling certain model year 2011-2013 Ford Explorer vehicles manufactured May 17, 2010, through February 28, 2012. The affected vehicles may experience an intermittent connection in the electric power steering gear, which can cause a loss of the motor position sensor signal resulting in a shut down of the power steering assist. If the vehicle experiences a loss of power steering assist it will require extra steering effort at lower speeds, increasing the risk of a vehicle crash. Ford will notify owners, and dealers will update the Power Steering Control Module (PSCM) software, free of charge. If a vehicle shows a history of a loss of motor position sensor signal when the vehicle is brought in for the recall remedy, its steering rack assembly will be replaced, free of charge. The recall is expected to begin by July 25, 2014. Owners may contact Ford customer service at 1-800-392-3673. Ford's number for this recall is 14S06.

14V-286

Terex South Dakota, Inc. (Terex) is recalling certain model year 2006-2014 TLM series models manufactured from December 2006 through February 2014 which were installed on Ford F550 vehicles. The affected vehicles may develop a crack in a notch of the vehicle frame. A crack in the frame may cause frame failure, resulting in a loss of vehicle control, increasing the risk of a crash. Terex will notify owners, and dealers will repair any cracked frames and install a preventative reinforcement on the affected vehicles which have not cracked, free of charge. The recall is expected to begin in July 2014. Owners may contact Terex customer service at 1-605-882-4000. Terex's number for this recall is SN610.

14V-287

Starcraft RV, Inc. (Starcraft) is recalling certain model year 2014 Autumn Ridge, AR-ONE, and Travel Star Exp trailers manufactured February 13, 2014, through February 24, 2014. The affected trailers may have been built with frame spring hangers that may be brittle and susceptible to fracturing. A spring hanger that fractures may result in a loss of control of the trailer, increasing the risk of a crash. Starcraft will notify owners, and dealers will inspect and replace the frame spring hangers, as necessary, free of charge. The recall is expected to begin in July 2014. Owners may contact Starcraft customer service at 1-800-945-4787.

14V-288

Kia Motors Corporation (Kia) is recalling certain model year 2014 Cadenza vehicles manufactured February 1, 2013, through August 27, 2013, and equipped with 19" non-chrome aluminum wheels. The wheels on the affected vehicles may fracture from impacts such as large, deep potholes. A wheel fracture could cause the circular rim to separate, resulting in a loss of tire pressure, increasing the risk of a crash. Kia will notify owners, and dealers will replace the wheels with new wheels, free of charge. The recall is expected to begin in July 2014.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING MAY 2014

Published July 3, 2014

Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC107.

14V-289

Champion Bus, Inc. (Champion) is recalling certain model year 2014 Defender shuttle buses built on Freightliner M2 chassis equipped with IMMI-brand L9 seat belt buckles. When the button is pressed to release the seat belt, the latch plate can become partially engaged with the buckle, making the seat belt difficult to unlatch. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 209, "Seat Belt Assemblies." If the latch plate remains partially engaged after the button is pressed, egress from the vehicle could be hindered which would increase the risk of injury in the event of an emergency. Daimler Trucks North America (DTNA), manufacturer of the Freightliner chassis, has notified owners, and DTNA dealers will inspect and replace the seat belt buckle, as necessary, free of charge. The recall began on May 27, 2014. Owners may contact Champion Bus at 1-810-724-6474 or DTNA at 1-800-385-4357.

14V-302

Champion Bus, Inc. (Champion) is recalling certain model year 2014 Defender shuttle buses built on Freightliner M2 chassis, equipped with Eaton-brand hybrid automated transmissions. The software controlling the affected transmissions may improperly raise the vehicle's engine speed during downshifts without the driver's input. The increase in engine speed may result in unintended acceleration, increasing the risk of a crash. Daimler Trucks North America (DTNA), manufacturer of the Freightliner chassis, has notified owners, and Eaton authorized service facilities has updated the Hybrid Control Module Software version, free of charge. The recall began in May 2014. Owners may contact Champion Bus at 1-810-724-6474. Customers may also contact Eaton at 1-800-386-1911.

14V-303